General Purpose Jobber Length Drill - Left Hand

Style
L10

How To Use This Chart:

1.Determine your Workpiece Material from the Application Material Groups (AMG) below.

2.Use the Icons to find Product Features.

3.Find the Surface Feet Per Minute (SFM) and Alpha Code

example: 361W

361 = SFM

W = Alpha Code used to find your Feed Rate

HSS

ANSI

4XD

118°

L10

1/32 - 1/2

	85
1.1	115H
1.2	98H
1.3	82F
1.4	66F
1.5	43E
1.6	30D
1.7	
1.8	
2.1	49E
2.2	26G
2.3	30C
2.4	
3.1	98H
3.2	79F
3.3	66E
3.4	46E
4.1	75E
4.2	39D
4.3	20B
5.1	33G
5.2	20E
5.3	10A
6.1	108G
6.2	115I
6.3	89H
6.4	52G
7.1	108J
7.2	98I
7.3	89H
7.4	79F
8.1	98J
8.2	92H
8.3	46F
9.1	10B
10.1	

Feed Rate Chart

Alpha Code	Feed in Inches per Revolution (IPR) ± 25% — Ø Diameter															
	1mm/ 1/32"	2mm/ 3/32"	3mm/ 1/8"	4mm/ 5/32"	5mm/ 3/16"	6mm/ 1/4"	8mm/ 5/16"	10mm/ 3/8"	12mm/ 1/2"	15mm/ 9/16"	16mm/ 5/8"	20mm/ 3/4"	25mm/ 1"	30mm/ 1.1/8"	40mm/ 1.5/8"	50mm/ 2"
A	0.0004	0.0009	0.0011	0.0013	0.0014	0.0017	0.0021	0.0024	0.0027	0.0032	0.0034	0.0043	0.0049	0.0053	0.0061	0.0069
B	0.0006	0.0011	0.0015	0.0016	0.0018	0.0021	0.0026	0.0031	0.0035	0.0041	0.0043	0.0053	0.0060	0.0065	0.0074	0.0082
C	0.0006	0.0013	0.0017	0.0020	0.0022	0.0025	0.0031	0.0039	0.0043	0.0049	0.0051	0.0063	0.0071	0.0077	0.0087	0.0094
D	0.0006	0.0015	0.0021	0.0024	0.0027	0.0031	0.0039	0.0047	0.0051	0.0059	0.0061	0.0074	0.0083	0.0090	0.0100	0.0108
E	0.0007	0.0017	0.0024	0.0028	0.0031	0.0037	0.0045	0.0055	0.0059	0.0068	0.0071	0.0085	0.0094	0.0102	0.0112	0.0122
F	0.0007	0.0020	0.0029	0.0033	0.0037	0.0043	0.0054	0.0065	0.0070	0.0080	0.0083	0.0098	0.0108	0.0116	0.0126	0.0135
G	0.0007	0.0022	0.0033	0.0038	0.0043	0.0050	0.0063	0.0075	0.0081	0.0091	0.0094	0.0110	0.0122	0.0130	0.0140	0.0148
H	0.0008	0.0026	0.0040	0.0046	0.0051	0.0059	0.0075	0.0090	0.0096	0.0107	0.0110	0.0126	0.0140	0.0148	0.0157	0.0165
I	0.0008	0.0030	0.0047	0.0053	0.0059	0.0068	0.0087	0.0104	0.0110	0.0122	0.0126	0.0142	0.0157	0.0165	0.0173	0.0181
J	0.0009	0.0033	0.0053	0.0060	0.0067	0.0078	0.0098	0.0117	0.0124	0.0137	0.0142	0.0159	0.0175	0.0183	0.0191	0.0198
K	0.0010	0.0036	0.0059	0.0067	0.0075	0.0087	0.0110	0.0130	0.0138	0.0153	0.0157	0.0177	0.0193	0.0201	0.0209	0.0215
L	0.0011	0.0040	0.0065	0.0073	0.0082	0.0094	0.0120	0.0142	0.0152	0.0165	0.0169	0.0191	0.0207	0.0215	0.0224	0.0231
M	0.0012	0.0043	0.0071	0.0080	0.0089	0.0102	0.0130	0.0154	0.0165	0.0177	0.0181	0.0205	0.0220	0.0228	0.0238	0.0248
N	0.0013	0.0047	0.0077	0.0086	0.0095	0.0110	0.0140	0.0165	0.0179	0.0189	0.0193	0.0219	0.0234	0.0242	0.0253	0.0265
S	0.0003	0.0006	0.0008	0.0010	0.0012	0.0015	0.0020	0.0031	0.0039	0.0048	0.0051	0.0059	0.0070	0.0070	0.0090	
T	0.0006	0.0011	0.0016	0.0020	0.0024	0.0028	0.0035	0.0043	0.0051	0.0063	0.0067	0.0075	0.0080	0.0090	0.0100	
U	0.0010	0.0019	0.0028	0.0031	0.0035	0.0042	0.0055	0.0067	0.0079	0.0088	0.0091	0.0094	0.0110	0.0120	0.0140	
V	0.0015	0.0027	0.0039	0.0045	0.0051	0.0060	0.0079	0.0098	0.0110	0.0122	0.0126	0.0134	0.0160	0.0170	0.0200	
W	0.0019	0.0035	0.0051	0.0059	0.0067	0.0079	0.0102	0.0130	0.0150	0.0165	0.0169	0.0177	0.0190	0.0190	0.0200	
X	0.0022	0.0041	0.0059	0.0071	0.0083	0.0098	0.0130	0.0165	0.0189	0.0210	0.0217	0.0228				
Y	0.0027	0.0049	0.0071	0.0087	0.0102	0.0125	0.0169	0.0217	0.0276	0.0276	0.0276	0.0291				
Z	0.0037	0.0068	0.0098	0.0128	0.0157	0.0210	0.0315	0.0394	0.0433	0.0463	0.0472	0.0472				

How To Use This Chart to Find Cutting Feed Rate (IPR):

1. Find your Alpha Code on the AMG Chart (example: 279 U : U is the Alpha Code)
2. Find the closest diameter for your cutting application on the chart to find your IPR

Application Material Groups (AMG)			Hardness HRC	ISO
1. Steel	1.1 Magnetic soft steel	12L14, 12L15	<120 HB	P 1
	1.2 Structural Steel/ case carburising steel	1005-1025, 1214, 1215, A36	<200 HB	P 1
	1.3 Plain Carbon steel	1030-1060, 1050-1060, 1144-1146	<24	P 2
	1.4 Alloy steel	4140,4340,52100,8620 H11-H41,A2,D2,01,P20,420	<24	P 3
	1.5 Alloy steel/ Hardened and tempered steel	4140,4340,52100,8620 H11-H41,A2,D2,01,P20,420	>24<38	P 4
	1.6 Alloy steel/ Hardened and tempered steel	4140,4340,52100,8620 H11-H41,A2,D2,01,P20,420	>38	H 1
	1.7 Alloy steel Hardened	A2-D2, H10-H41, L1-L6, M1-M42, T1	49-55	H 3
	1.8 Alloy steel Hardened	A2-D2, H10-H41, L1-L6, M1-M42, T1	55-63	H 4
2.Stainless Steel	2.1 Free machining Stainless Steel	200, 303, 416, 420F, 430F, 440	<24	M 1
	2.2 Austenitic	301, 302, 304, 316, 321, 330, CUSTOM 455, AM-350	<24	M 3
	2.3 Ferritic + Austenitic, Martensitic	318-329, 400-446, DUPLEX	<32	M 2
	2.4 Precipitation Hardened	15-5PH, Custom 450 17-4PH	<32	S 2
3.Cast Iron	3.1 Lamellar graphite	Grey, G10, Gg40, J431C, A48 CLASS 20	<150 HB	K 1
	3.2 Lamellar graphite	Grey, GG25-Gg40, J158, A48 CLASS 40-60	>150 HB<32	K 2
	3.3 Nodular graphite/ Malleable Cast Iron	A220, A436, A439, A602, Black, GGG40-GGG70	<200 HB	K 3
	3.4 Nodular graphite/ Malleable Cast Iron	Black Gts/Gtw, J434C	>200 HB<32	K 4
4.Titanium	4.1 Titanium, unalloyed	Commercially Pure	<200 HB	S 1
	4.2 Titanium, alloyed	6Al4V, 6A14V-2Sn, Monel, Monel K	<28	S 2
	4.3 Titanium, alloyed	6Al4V-4Mo, 7A14V-4Mo, 4911-4967	>28<38	S 3
5.Nickel	5.1 Nickel, unalloyed	Commercially Pure, 17644, 200, 5553	<150 HB	S 1
	5.2 Nickel, alloyed	Monel 400, Hastelloy C, Inconel 625, Waspaloy	<28	S 2
	5.3 Nickel, alloyed	Iconel 718,Nimonic 75-95,Rene 41,Iconel 825,A286	>28<38	S 3
6.Copper	6.1 Copper	Commercially Pure	<100 HB	N 3
	6.2 ß-Brass, Bronze	314-340, 350-370	<200 HB	N 4
	6.3 α-Brass	Alloyed Cu + Al + Fe, Long Chipping	<200 HB	N 3
	6.4 High Strength Bronze	Ampco 18-25	<49	N 4
7.Aluminium Magnesium	7.1 Al, Mg, unalloyed	Commercially Pure	<100 HB	N 1
	7.2 Al alloyed, Si<0.5%	6061 T6, 7075, 314-340	<150 HB	N 1
	7.3 Al alloyed, Si>0.5%<10%	6061 T6, 380-390	<120 HB	N 1
	7.4 Al alloyed, Si>10% Mg alloys	Magnesium Whisker Reinforced	<120 HB	N 2
8.Synthetic Materials	8.1 Thermoplastics	Ultramid, Polystrol	---	O
	8.2 Thermosetting plastics	Bakelit, Pertinax	---	O
	8.3 Reinforced plastic materials	CFK, GFKAFK	---	O
9.Hard Mat.	9.1 Cermets (Metal-ceramics)	Ferrotic	<54	H
10.Graphite	10.1 Standard graphite		---	O

JOBBER DRILL

General Purpose Jobber Length - Left Hand

L10 Left hand helix for use in machines where spindle is counter-clockwise & can be used to remove broken parts without damaging threaded holes. Bright Finish improves chip flow in soft or non-ferrous materials

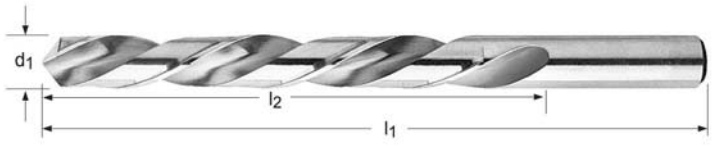

L10

ANSI

4XD

HSS

118°

1/32 - 1/2

d_1 Ø Inch	d_1 decimal Inch	l_2 Inch	l_1 Inch	Pack Qty	L10
1/32	0.0313	1/2	1.3/8	12	010902
3/64	0.0469	3/4	1.3/4	12	010903
1/16	0.0625	7/8	1.7/8	12	010904
5/64	0.0781	1“	2“	12	010905
3/32	0.0938	1.1/4	2.1/4	12	010906
7/64	0.1094	1.1/2	2.5/8	12	010907
1/8	0.1250	1.5/8	2.3/4	12	010908
9/64	0.1406	1.3/4	2.7/8	12	010909
5/32	0.1563	2“	3.1/8	12	010910
11/64	0.1719	2.1/8	3.1/4	12	010911
3/16	0.1875	2.5/16	3.1/2	12	010912
13/64	0.2031	2.7/16	3.5/8	12	010913
7/32	0.2188	2.1/2	3.3/4	12	010914
15/64	0.2344	2.5/8	3.7/8	12	010915
1/4	0.2500	2.3/4	4“	12	010916
17/64	0.2656	2.7/8	4.1/8	12	010917
9/32	0.2813	2.15/16	4.1/4	12	010918
19/64	0.2969	3.1/16	4.3/8	12	010919
5/16	0.3125	3.3/16	4.1/2	6	010920
21/64	0.3281	3.5/16	4.5/8	6	010921
11/32	0.3437	3.7/16	4.3/4	6	010922
23/64	0.3594	3.1/2	4.7/8	6	010923
3/8	0.3750	3.5/8	5“	6	010924
25/64	0.3906	3.3/4	5.1/8	6	010925
13/32	0.4063	3.7/8	5.1/4	6	010926
27/64	0.4219	3.15/16	5.3/8	6	010927
7/16	0.4375	4.1/16	5.1/2	6	010928
29/64	0.4531	4.3/16	5.5/8	6	010929
15/32	0.4687	4.5/16	5.3/4	6	010930
31/64	0.4844	4.3/8	5.7/8	6	010931
1/2	0.5000	4.1/2	6“	6	010932